


Slip Indicator Light Remains ON

DESCRIPTION

- The SLIP indicator blinks when any of the TRAC, VSC and AUTO LSD operate.
- When the system fails, the SLIP indicator light illuminates to warn the driver.

BC

WIRING DIAGRAM

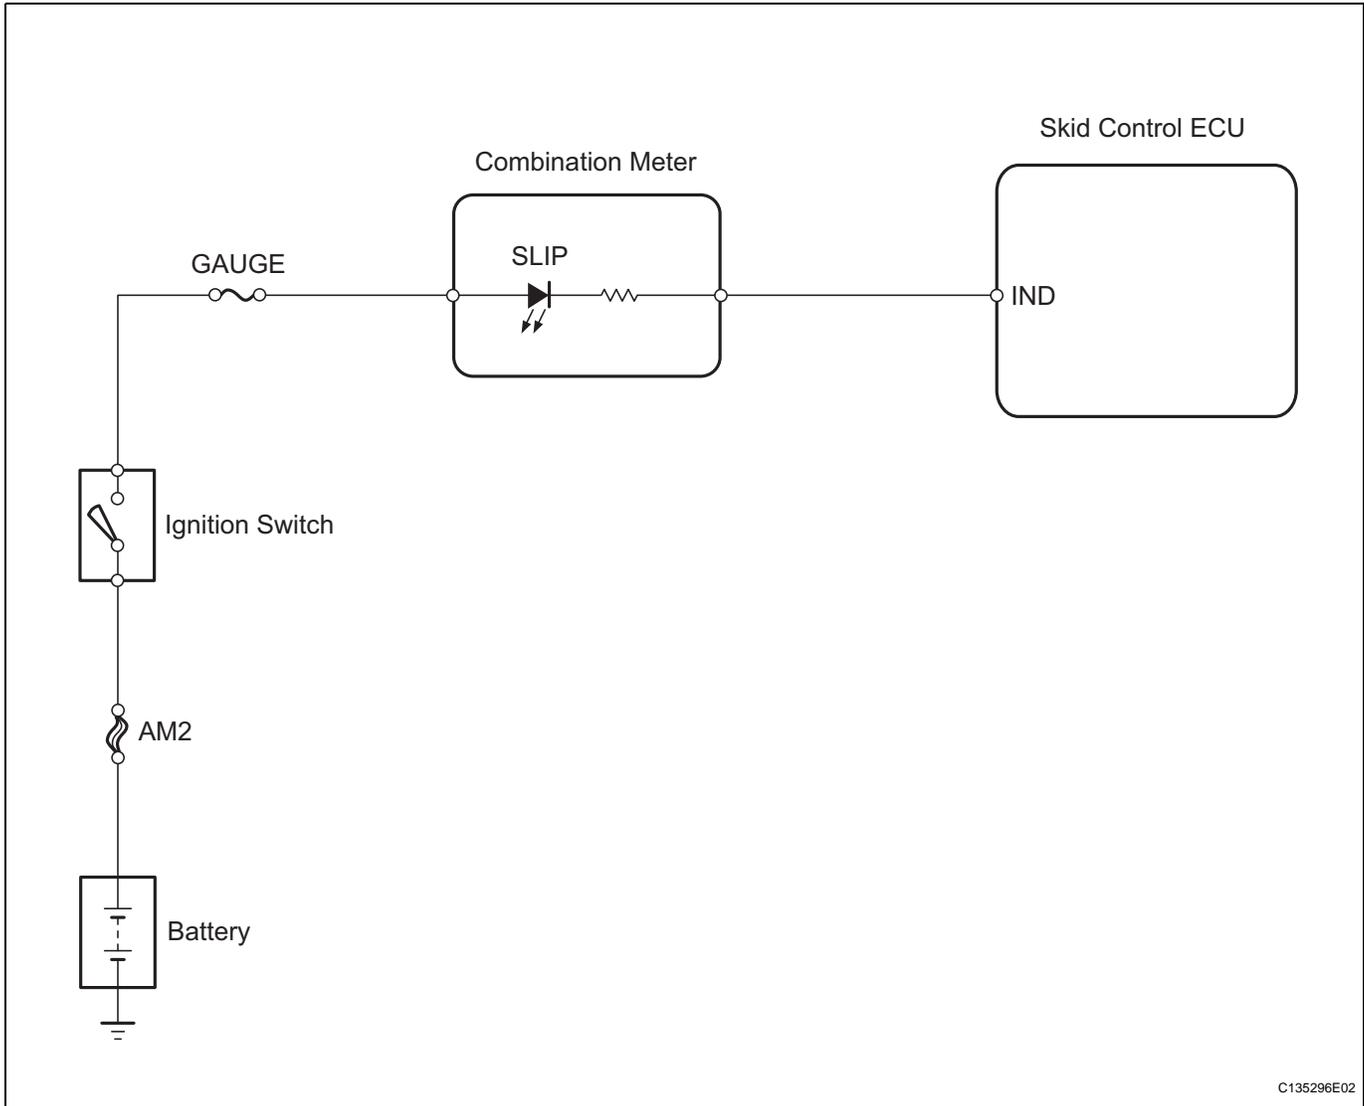

INSPECTION PROCEDURE

NOTICE:

When replacing the master cylinder solenoid, perform zero point calibration (See page [BC-24](#)).

1	CHECK DTC
----------	------------------

(a) Check for the DTCs (See page [BC-45](#)).

Result


Result	Proceed to
DTC not output	A
DTC output	B

B REPAIR CIRCUITS INDICATED BY OUTPUT DTCS

A

2 CHECK HARNESS AND CONNECTOR (SKID CONTROL ECU - COMBINATION METER)

BC

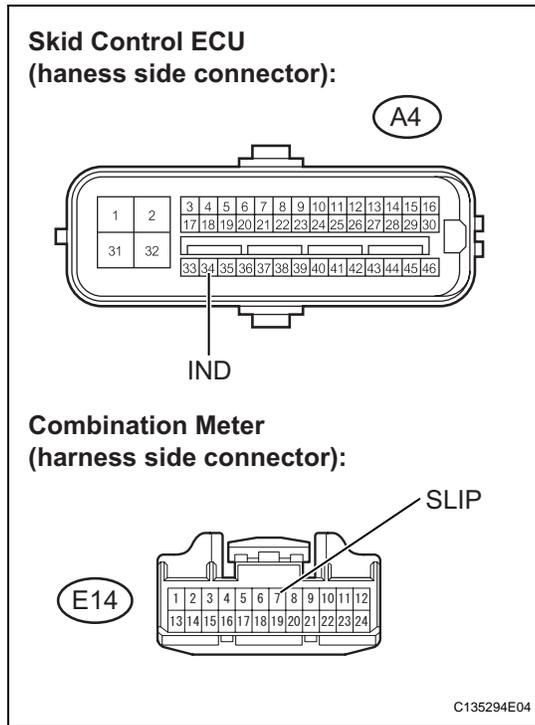

- (a) Disconnect the skid control ECU connector.
- (b) Disconnect the combination meter connector.
- (c) Measure the resistance.

Standard resistance

Tester Connection	Specified Condition
A4-34 (IND) - E14-7 (SLIP)	Below 1 Ω
A4-34 (IND) - Body ground	10 kΩ or higher

NG REPAIR OR REPLACE HARNESS OR CONNECTOR

OK

3 INSPECT COMBINATION METER ASSEMBLY

- (a) Check the combination meter system (See page [ME-29](#)).
- OK:**
Combination meter is normal.

NG REPLACE COMBINATION METER ASSEMBLY

OK

REPLACE MASTER CYLINDER SOLENOID